

Technical Bulletin

Urea Assay Kit III

Catalogue number MAK471

Product Description

Urea is the major end product of protein catabolism in animals. Urea is primarily produced in the liver and secreted by the kidneys. It is the primary vehicle for removal of toxic ammonia from the body. Urea determination is useful in assessing kidney function. In general, increased urea levels are associated with nephritis, renal ischemia, urinary tract obstruction, and certain extrarenal diseases (for example, congestive heart failure, liver diseases, and diabetes). Decreased levels often indicate acute hepatic insufficiency but may also result from over vigorous parenteral fluid therapy.

Simple, direct, and automation-ready procedures for measuring urea or Blood Urea Nitrogen (BUN) are popular in research and drug discovery. The Urea Assay Kit III is designed to directly measure urea in biological samples. In this assay, urease converts urea to ammonia and carbon dioxide. NADH is then converted to NAD+ in the presence of ammonia, a-ketoglutarate, and glutamate dehydrogenase. The decrease in optical density at 340 nm is directly proportional to the urea concentration in the sample.

The linear detection range of the kit is 50 to 1000 μ M urea in the 96-well plate assay. The kit is suitable for detection of urea in biological samples such as plasma, serum, urine, bronchoalveolar lavage (BAL), and food/beverage samples such as milk.

Components

The kit is sufficient for 100 spectrophotometric assays in 96-well plates.

•	Assay Buffer Catalogue Number MAK471A	20 mL
•	Enzyme Catalogue Number MAK471B	120 µL
•	Ketoglutarate Catalogue Number MAK471C	120 µL
•	Urease Catalogue Number MAK471D	120 µL
•	NADH Reagent Catalogue Number MAK471E	1 Vial
•	Standard (40 mM) Catalogue Number MAK471F	400 μL

Equipment Required but Not Provided

- Pipetting devices and accessories (such as, multichannel pipettor)
- Spectrophotometric multiwell plate reader
- Clear flat-bottom 96-well plates. Cell culture or tissue culture treated plates are not recommended.
- Microcentrifuge capable of RC ≥14,000×g
- 1.5 mL microcentrifuge tubes

Precautions and Disclaimer

For Research Use Only. Not for use in diagnostic procedures. Please consult the Safety Data Sheet for information regarding hazards and safe handling practices.

Storage/Stability

The kit is shipped on wet ice. Store components at -20 °C.



Preparation Instructions

Briefly centrifuge small vials prior to opening.

Equilibrate all components to room temperature prior to use.

NADH Reagent: Reconstitute vial with 1 mL of purified water (final concentration is 10 mM). Unused reconstituted NADH reagent is stable for three weeks when stored frozen at -20 °C.

Procedure

All Samples and Standards should be run in duplicate.

Sample Preparation

- Serum and plasma samples should be centrifuged to remove any particulates and then diluted 10fold in purified water (DF = 10).
- 2. Urine should be diluted 500-fold in purified water (DF = 500).
- 3. Milk samples should be cleared by mixing 600 μ L of milk with 100 μ L of 6 N HCl. Centrifuge for 5 minutes at 14,000 \times g at room temperature. Transfer 300 μ L of supernatant into a clean tube and neutralize with 50 μ L of 6 N NaOH. The neutralized supernatant should then be diluted 20 fold in purified water (DF = 27.2).
- 4. Avoid use of cell culture media containing phenol red. Other media can be assayed directly.
- 5. Samples should be clear and colorless with pH adjusted to 7 8.
- 6. Transfer 20 μ L of each Sample into duplicate separate wells of a clear 96 well plate. One well will be used as the reaction Sample and the duplicate well the Sample Blank.

Standard Curve Preparation

1. Prepare a 1000 μ M Urea Standard by mixing 15 μ L of the 40 mM Urea Standard with 585 μ L of purified water. Prepare Urea Standards in 1.5 mL microcentrifuge tubes according to Table 1.

Table 1. Preparation of Urea Standard

Standard	1000 µM Urea Standard	Purified Water	Urea (µM)
1	100 μL	-	1000
2	60 μL	40 μL	600
3	30 μL	70 μL	300
4	-	100 μL	0

2. Mix well and transfer 20 μ L of each Standard into separate wells of the plate.

Working Reagents

- 1. Mix enough reagents for the number of assays to be performed. Prepare Working Reagents according to Table 2.
- a. For each Urea Standard and Sample well, prepare 191 μL of Working Reagent.
- b. For each Sample Blank well, prepare 190 μL of Blank Working Reagent.

Table 2. Preparation of Working Reagents

Reagent	Working Reagent	Blank Working Reagent
Assay Buffer	180 µL	180 μL
Enzyme	1 μL	1 μL
NADH Reagent	8 μL	8 µL
Ketoglutarate	1 μL	1 μL
Urease	1 μL	-

- 2. Add 180 μL of Working Reagent to each Standard and Sample well.
- 3. Add 180 μ L of Blank Working Reagent to each Sample Blank well.
- 4. Tap the plate to mix.

Measurement

- 1. Incubate the plate for 30 minutes at room temperature.
- 2. Read optical density (OD) at 340 nm.

Results

- 1. Calculate Δ OD by subtracting the blank OD reading of Standard #4 (Blank) from the remaining Standard reading values.
- 2. Plot the ΔOD against standard concentrations.
- 3. Determine the slope of the standard curve and calculate the urea concentration of the Sample.

$$Urea (\mu M) = \frac{OD_{Blank} - OD_{Sample}}{Slope (\mu M^{-1})} \times DF$$

where:

 $OD_{Sample} = OD reading of Sample$

 $OD_{Blank} = OD$ reading of Sample Blank

DF = Sample dilution factor (DF = 1 for undiluted samples)


Conversions: 1000 μM urea equals 6 mg/dL or 60 ppm.

Urea BUN (mg/dL) = [Urea] (mg/dL) / 2.14

If the calculated urea concentration is higher than 1000 μ M, dilute the sample in purified water and repeat the assay. Multiply result by the dilution factor (DF).

Figure 1.

Typical Urea Standard Curve

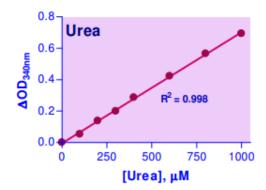

Notice

We provide information and advice to our customers on application technologies and regulatory matters to the best of our knowledge and ability, but without obligation or liability. Existing laws and regulations are to be observed in all cases by our customers. This also applies in respect to any rights of third parties. Our information and advice do not relieve our customers of their own responsibility for checking the suitability of our products for the envisaged purpose.

The information in this document is subject to change without notice and should not be construed as a commitment by the manufacturing or selling entity, or an affiliate. We assume no responsibility for any errors that may appear in this document.

Technical Assistance

Visit the tech service page at SigmaAldrich.com/techservice.

Terms and Conditions of Sale

Warranty, use restrictions, and other conditions of sale may be found at SigmaAldrich.com/terms.

Contact Information

For the location of the office nearest you, go to SigmaAldrich.com/offices.

